
1 JULY 1952

C.PP. psigp. Aluminum Household Effects Shipping Container

9 9 Distribution of this document is uninvited. SH

PROTECTION AGAINST DAMAGE

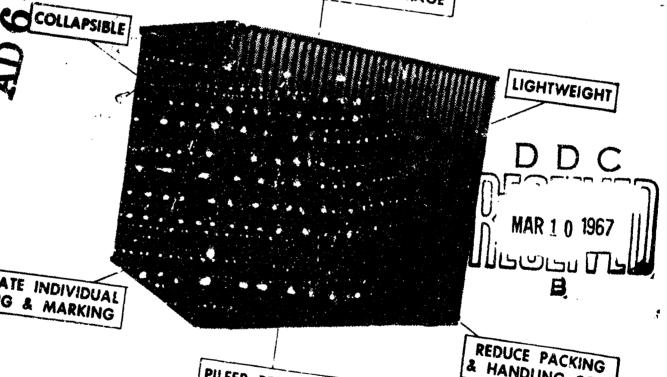

& HANDLING COST

ELIMINATE INDIVIDUAL PACKING & MARKING

PILFER RESISTANT

ARCHIVE COPY

U.S. Naval Supply Research & Development Facility SUPPLY ENGINEERING DIVISION Bayonne, Mcw Jarsey

RESEARCH AND DEVELOPMENT DIVISION BUREAU OF SUPPLIES AND ACCOUNTS WASHINGTON, D.C.

TECHNICAL REPORT REVIEW

"EVALUATION OF AN EXPERIMENTAL COLIAPSIBLE ALUMINUM HOUSEHOLD EFFECTS CONTAINER"

Engineering Report #2.2020254 29 December 1950 under Project No. NTOC3016

APPROVAL:

Report Approved 12 March 1951

SECURITY CLASSIFICATION:

Distribution of this document

UNCLASSIFIED is unlimited.

DISTRIBUTION:

In accordance with the attached approved distribution

list.

REMARKS:

This technical report review is inserted as the first page of the subject report as an integral part thereor.

No data, discussions or recommendations included in this research and development report or technical report review shall be construed as indicating a current or anticipated future operating policy of the Bureau of Supplies and Accounts or the Navy Department.

/s/ J. H. TAYLOR, Jr.
Commander, (SC), USN
Director, Research and Development Division
By direction of the Chief of Bureau

Supply Engineering Division U. S. Haval Supply Research and Development Facility Haval Supply Depot Bayonne, New Jersey

PROJECT CHOUP - NT-003-016 PROJECT EXPORT - 2.2020254

EVALUATION OF AN EXPERIMENTAL COLLAPSIBLE ALIGHNUM HOUSEHOLD EFFECTS CONTAINER

AUTHORIZATION:

ChBuSandA ltr to OIC, USNSHDF, BayNJ, file S-82 (HER:el)S-30-3(10), dtd 26 July 1950

PURPOSE:

To evaluate the performance of a Collapsible Aluminum Household Container manufactured by Northwest Consolidators, 402 Loman Building, Seattle 4, Washington, and determine its acceptability for Navy use.

CONCLUSION:

- The aluminum household container is structurally sound.
- 2. The load capacity may be safely increased from the rated 1800 lbs. (7.5 lbs. per cu.ft.) to 3700 lbs. (15 lbs. per cu.ft.)
- 3. The sling hooks (lifting lugs) are inadequate and should not be used for handling purposes.

- 4. Prolonged exposure to weather or salt spray should be avoided.
- 5. The roof design precludes tiering of containers.

INTRODUCTION

The Bureau of Supplies and Accounts procured an experimental lot of thirty (30) Collapsible Aluminum Household Effects Containers, which were Matributed as follows:

- 24 Containers to Naval Supply Center, Oakland, California
- 5 Containers to Naval Supply Depot, Seattle, Washington
- 1 Container to U.S. Naval Supply Research and Development
 Facility, Bayonne, New Jersey

The experimental container was subjected to a series of accelerated laboratory and field tests, designed to simulate all possible hazards that the container may encounter during warehousing, stevedoring, and transportation operations. The conclusions and recommendations in this report are based on the results of these tests.

Field activities have been requested to submit operational usage data on each container in actual use. When sufficient data is accumulated, it will be evaluated and incorporated in a final report.

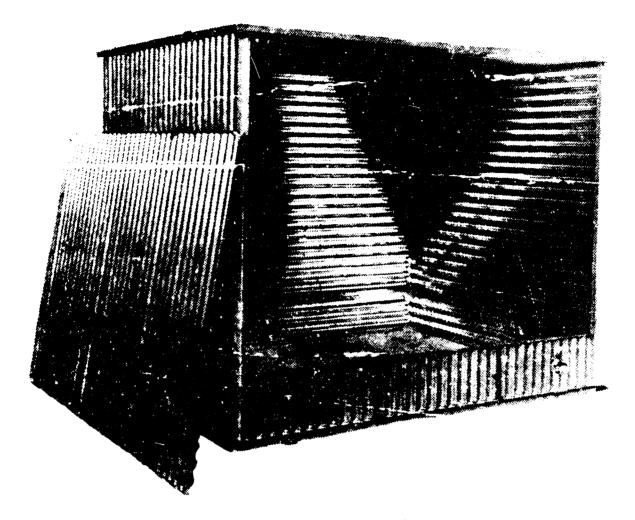


Photo Neg. No. USNSRDF 535-5

ASSECULED UNIT

Overall Dimensions - 96-1/2" x 71" x 78" high

Shipping Cubs - 310 Cubic Feet

Clear Inside Dimensions - 91" x 56" x 71-1/4" high

Cargo Cube - 243 Oubic feet

Tare Weight - 535 lbs.

Skid Height - 4*

Assembly Time - 1.5 Man hours

Disassembly Time - 1.1 Man hours

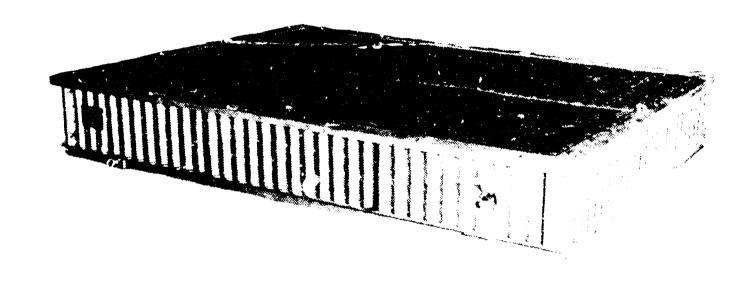


Photo Neg. No. USNSRDF 522-1

*NOCKDOWN UNIT

Overall Dimensions - 96-1/2* x 71* x 17-1/2*

Shipping Cube - 69.5 Cubic feet

Tare Weight - 535 lbs.

CONSTRUCTION - Drawing No. CC12-2, D.C. Taylor, 402 Isman Building, Seattle, Washington

The basic construction of the container consists of corrugated aluminum success with the corrugations .87% deep and with a pitch of 2.67%. The unit is assembled with 3/8% - 16 N.C. steel nuts and bolts.

Floor Section - Double aluminum corrugated sheets riveted perpendicular to each other, lower sheet - .064" thick, upper sheet - .032" thick. Loose 3/8" plywood sheet is placed within to act as flooring.

Side Sections - Double aluminum corrugated sheets, .032" thick, riveted perpendicular to each other.

Boof Section - 3/16" aluminum plate riveted to .032" corrugated aluminum sheet.

Framing - All framing members are made of aluminum extrusions and have the following shapes:

Floor Framing - 1-1/4" x 2" x 1-1/4" x 3/16" Z Section Corne. Posts - 1-1/4" x 2" x 1-1/4" x 3/16" Z Section Roof Framing - 1" x y-1/4" x 1/8" angle Side Panel Framing - 1-1/4" x 1-1/4" x 1/8" angle

Skids - Two 4° x 2.66° structural aluminum I beams with 10° x 2-1/2° openings for fork trucks.

Sling Hooks - Four 1" eye bolts, 3/8" shank, bulted to floor frame members.

METHOD OF TEST

1. Determination of Characteristics

a. Weight and Cube

The container was weighed and all pertinent dimension taken to ascertain the shipping and cargo cube of the container when fully assembled, as well as the shipping cube when the container is knockdown.

b. Time required for Assembly and Disassembly

The container was assembled and disassembled by two men using 9/16" box wrenches. The assembly time included the unbolting of the roof from the lower side panels and complete erection of the unit. Similarly, the disassembly time included the complete dismantling of the unit, placing the upper side panels into the lower section, and bolting the roof on the lower side panels.

2. Meather Resistance Test

To simulate a heavy rain, the container was subjected to a water spray from a 1-1/2" fire hose equipped with a fog nozzle. The spray was directed at the test unit from various directions and angles for a period of thirty minutes. At the conclusion of the test, a side panel was removed and the interior of the unit was examined for evidence of water entry.

3. Load Test

The container was loaded to its rated capacity of 1800 lbs. with a well balanced load so that shifting was held to a minimum. The deflection in the floor section was then determined.

4. Handling Test

- a. The loaded container was lifted with a 6000 lb. fork truck and transported approximately 50 feet. Ease of entry of forks into openings in skids was noted.
- b. Two wire slings were placed under the floor of the container adjacent to the skids. The loaded unit was then lifted by a crane. Resistance of the bottom edges of the container to crushing was noted.
- c. The container was placed on 6" wood rollers. The test unit was moved approximately 50 ft. on these rollers. Particular attention was paid to the deflection of the skids at the fork truck openings.

5. Edge Drop Test

One skid of the test unit was placed on a 6" x 8" timber approximately 8 feet long. The other side of the container was lifted by fork truck and a 4" x 4" x 18" block was placed vertically under one corner. The container was examined in this position and any undue deflection or wracking noted. The 4" x 4" x 18" block was then pulled out from under the unit

allowing the container to strike the pavement with a fall of 18". This operation was repeated by placing the block under each of the four coracre successively, and then repeated again using a 4" x 4" x 24" block. At the conclusion of the test the floor was examined for further deflection.

6. Stovedoring Test

- a. This test was designed to determine the suitability of the container for stevedoring operations. It was exposed to simulated conditions which might be encountered due to faulty cargo handling equipment, improper operation by personnel, or unavoidable circumstances when being loaded on or unloaded from cargo ships. The test was divided into three parts.
- (1) Shub Test The loaded container was lifted approximately 25 ft. above the ground by a crane equipped with wire slings.

 The brake of the crane was released and the container lowered at full speed until it reached a point approximately 5 feet above ground. At that time, the brake was applied suddenly and the load brought to a quick halt. This test was repeated twice.
- (2) <u>Drop Test</u> The loaded container was lifted by a crane equipped with slings to a point 18 " above the ground. The bruke of the crane was released and the test unit dropped freely with the skids

striking the concrete pavement squarely. This operation was repeated a second time with the container falling freely from a point $2h^n$ above the ground.

(3) Swing Test - To simulate a container striking the ship's side during hoisting and loading operation, the test unit was held by a crane approximately one foot above the ground next to a substantially solid wall. The container was pulled away from the wall a distance of approximately 10 feet with a cable attached to a fork truck and equipped with a quick release mechanism. The release mechanism was activated and the container was allowed to strike the wall squarely on a side panel. The operation was repeated and the container so held that it struck the wall squarely at a corner.

At the conclusion of these tests, the container was examined for floor deflection and other damage. It was dismantled to determine ease of disassembly.

A 125% overload was added, making a total lead of 4000 lbs. in the "ast unit, and tests No. 3 through 6 inclusive were repeated. At the conclusion of the second series of tests, the container was re-examined and again disassembled and assembled.

SUMMARY OF TEST RESULTS

1. Assembly and Disassembly

Initial assembly of the Collapsible Aluminum Household Effects

Container disclosed that five bolt holes did not line up. These holes

were enlarged in order that the container could be fully assembled.

Bolting the upper and lower side panels together was awkward and time consuming due to the small clearance around the bolt heads. These bolts are located between the aluminum corrugations and it is necessary to use 9/16" box wrenches to effectively turn them. Even then, the bolts can only be turned less than 90 degrees at one time.

2. Weather Resistance

The weather resistance test disclosed that a small amount of water seeped in between the horizontal angles connecting the upper and lower side panels. This condition is undesirable if the loaded container is to be exposed to the elements for any practical length of time.

3. Load Test

There was no appreciable deflection in the floor of the container when it was loaded, as rated, with 1800 lbs. When the load was increased to 4000 lbs., the maximum deflection in the floor was approximately 1/4". This deflection is not excessive and the aluminum corrugations were not stressed beyond their elastic limit.

4. Handling

The lifting lugs, or sling hooks for this container consist of four l'eye bolts with 3/8" shanks bolted to the floor framing sections. They

could not be tested since one was torn off the container during transit from the west coast and another so weakened that it snapped when a slight force was applied to it. In lieu of the lifting lugs, two wire slings were placed under the container, parallel and adjacent to the skids, and the unit was then lifted by a crane. In addition to being lifted by a crane, the Handling Test indicated the loaded unit can be readily handled by a fork truck or moved a short distance as into the wings of a ship by wooden rollers.

5. Edge Drop and Stevedoring

The container when loaded either with 1800 lbs. or 4000 lbs. withstood the Edge Drop Test and Stevedoring Tests in an excellent manner.

The unit was slightly damaged during these tests. The damage consisted of minor deformation of corrugations, bending of roof corner, etc., and did not impair the further utilization of the container.

At the conclusion of the tests the container was discassembled, unloaded, inspected, and reassembled again without too much difficulty.

Only one bolt could not be replaced.

CONCLUSIONS AND RECOMMENDATIONS

The tests to which the container was subjected indicate that it is structurally sound. The manufacturer's rated load of 1800 lbs. equals

Since the container is structurally sound and successfully withstood the tests with a 4000 lo. lo.d., it is recommended that the rated capacity of this container be increased to 15 lbs. per cubic foot or 3700 lbs.

The eye bolt "sling hooks" are inadequate for lifting the container with a crane and should not be used for that purpose. Instead two wire slings should be placed under the container parallel and adjacent to the skids when the unit is to be lifted with a crane. The present sling hooks might be used to secure the unit to the eck of a truck, railway car or ship.

No means are provided in the interior of the container to fasten household articles to the floor or sides. It is recommended that either bars be welded to the interior corrugations of the side panels or some other means be provided to secure household articles within the container. This will require that one side panel be designated and so stenciled that it be the last panel bolted to the loaded container and the first panel unbolted when the container is to be unloaded.

If it is anticipated that the containers will be exposed to the elements for appreciable lengths of time, it is recommended that a thin gasket be secured to the lower framing angle of the upper side panels. This will provide a tight horizontal joint between side panels, and eliminate water from entering along that joint. If, however, the

anticipated usage of the container is such that it will seldom be exposed to the elements, the weather resistance, as presently constructed, is sufficient.

The roof design of the container is such that it precludes tiering of the containers, one on another, or placing of heavy loads on the roof.

Addendum to Evaluation of an Experimental Collapsible Aluminum Household Effects Container



SUPPLY ENGINEERING DIVISION

U.S.Navai Supply Research & Development Facility

Naval Supply Depot Bayonne, N.J.

RESEARCH AND DEVELOPMENT DIVISION BUREAU OF SUPPLIES AND ACCOUNTS WASHINGT , D.C.

TECHNICAL REPORT REVIEW

"ADDENDUM TO EVALUATION OF AN EXPERIMENTAL COLLAPSIBLE ALUMINUM HOUSEHOLD EFFECTS CONTAINER"

PROJECT GROUP - NTOO3-016(a) AUTHORIZATION - SE52-15 PROJECT REPORT - 2.2020251;

APPROVAL:

Report Approved 1 April 1952

SECURITY

CLASSIFICATION:

UNCLASSIFIED

DISTRIBUTION:

In accordance with the attached approved distribution

list.

REMARKS:

This technical report review is inserted as the first page of the subject report as an integral part

thereof.

No data, discussions or recommendations included in this research and development report or technical report review shall be construed as indicating a current or anticipated future operating policy of the Bureau of Supplies and Accounts or the Navy Department.

/s/ J.H. TAYLOR, JR.
Commander, (SC) USN
Director, Research and Development Division
By direction of the Chief of Bureau

SUPPLY ENGINEERING DIVISION U. S. NAVAL SUPPLY RESEARCH & DEVELOPMENT FACILITY Naval Supply Depot Bayonne, N. J.

PROJECT GROUP - NTOO3-016(a) AUTHORIZATION - SE52-15 PROJECT REPORT - 2.2020254

ADDENDUM TO EVALUATION OF AN EXPERIMENTAL COLLAPSIBLE ALUMINUM HOUSEHOLD EFFECTS CONTAINER

AUTHORIZATION: ChBuSandA ltr to OinC, USNSRDF, Bay, N. J., File OW-3 All/3 dtd 23 July 1951

PURPOSE:

Summation and evaluation of field reports and recommendations, to determine modifications for maximum utility of the container in the transportation of household effects.

CONCLUSION:

Minor modification and reinforcement using similar materials will permit conformance to recommendations received in field service reports.

SUMMATION OF FIELD REPORTS

- 1. Twenty-nine containers were distributed about October 1950 to the Naval Supply Center, Oakland, and the Naval Supply Depot, Seattle, to be used in normal transportation of household effects by common carrier. The using facilities were furnished forms and requested to supply data for field service evaluation and compilation by NSRDF.
- 2. Fifty-nine separate reports have been received to date covering twenty-seven of the containers, two have yet to be heard from, while the thirtleth is on hand in the laboratory, to be held for further development work.
- 3. Seventeen separate suggestions have been tabulated with frequency of mention as shown in Table A:

TABLE A	Number of Recommendations
Additional support required on bottom for protection against the forks.	5
A metal or plywood plaque to be provided for stenciling or attaching shipping identification and codes.	4
Stronger bolting or fastening on the opening side. In some cases the threads stripped under lead.	<u>L</u>
Provide interior fittings to permit stramping and bracing of a part load. These could be straps, bars, strap eyes or eye bolts.	2
Provide additional bracing for the top to support a lead.	2

TABLE A	Number of Recommendations
Furnish a third skid in the center for additional protection of the bottom gainst damage by fork trucks.	2
Top panel should be furnished in heavier gauge to resist cutting by sharp top loads.	2
Provide leveling blocks under flooring to prevent springing, so that bolting will be easy.	2
Use standard thread so that the bolts are easily replaceable from stock bins.	1
Place recessed handler in panels to eliminate handling hazard in assembly and disassembly.	1
The bottom portion of the front panel should be a permanent part of the base to pre int misalignment.	1
"Bolting" on front panel should be reversed so that vibration will not loosen the bolts and drop them out.	1
Use standard nuts and bolts through drilled holes instead of bolts in tapped holes.	ı
Develop a larger size container capable of carry- ing 3 or 4 rooms, this container was called a 12 to 2 room rize.	1
Attach bolts by a short length of chain.	1
Furnish a small centainer for excess bolts when not in use,	1
Place a pad eye on each corner of the top so that wire straps may be run through while loading and unloading on shipboard.	ı

h. Tranty-five of the reports characterized the centainers as either satisfactory, good or excellent. Twenty-five of the reports made no special comment, only finding in the blanks furnished.

5. Some selected comments:

- 1. On container #3, NAS, Pensacola, considered the aluminum containers more satisfactory than plywood which are frequently received from overseas in poor condition, i.e., the bottom pulled out and exposing the contents. Out of every fifty plywood containers received at Pensacola, approximately one is reusable.
- 2. On container #5, N. Y. Naval Shipyard, Brooklyn, estimates
 most shipment. of household effects within continental
 United States are by moving van. Therefore these containers
 were recommended for overseas shipments and consigned only
 to naval activities for use in return shipments.
- 3. On container #24, NCC, Morfolk advises the top was damaged, i.e., one foot long cut apparently made by a sharp instrument. There may have been an obtempt at militerare on this box car shipment, however, as nothing was reported missing, the second skin or inside corrugation may have saved the contents.
- 4. In me case was there any report of damage to the contents that could be assigned to the container construction.
- 6. The following modifications are applied to the design of the container to accommodate the most advantageous modifications recommended, and with a view toward using similar materials:
 - 1. An . Xoh aluminum sheet between the I beam skids and against the bottom corrugation for protection against fork truck forks.

- 2. A .064 aluminum plaque 18 x 24 placed on one long panel to permit marking with shipping identification and codes.
- 3. Bolt specifications changed to 7/16' 14 NC for increased strength, and one hole per fastening elongated to allow for inaccuracies in drilling.
- 4. Two vertical aluminum straps, 1 x 1/8 , per side, from top to bottom to permit tie-down of the load.
- 5. An additional corrugation added to the roof, believe and at right angles to the present corrugation.
- 6. Top panel flat sheet increased to .064 aluminum.
- 7. Two rope handles per panel recessed within corrugations to permit safe handling of panels.
- 8. An open top .032" aluminum box 32" x 32" x 32" placed in one corner to held excess bolts (and nuts) when disassembled.
- 7. The modification of this container for overseas transportation would require, as a minimum, attention to redesign and strengthening the unit for tiering or loading on top, and provision for lifting, such as sling hooks or eyes, or some type of lifting lug.

 At present, NSRDF has a sub-project NTCC3-016(a) to develop a similar container suitable for overseas use.
- 8. The containers were intended for movements within the continertal United States. However, nine of the containers did manage to move by sea transportation. These were:
 - #6 from Norfolk to Puerto Rico
 - #10 from Oakland to Pearl Harbor

#11, 16, 17 from Oakland to Fray 564

#15, 28 from San Diego to Norfolk (via LST)

#20 from Norfolk to Guantanamo Bay and return

#29 from Norfolk to Guantanamo Bay

- 9. (a) Appended is a shipment history by container number, date, destination, weight and corrier.
 - (b) The revised drawing is appended.

10, Discus lon

The .064* sheet under the bottom between the skids was considered necessary for protection against scuffing. Several pictures were furnished by using facilities showing gouging and scuffing from forks. It was noted in the laboratory test container that fifteen rivets in the bottom had failed around the corners. This occurred because the I beam skids were cut 1\frac{1}{4} inches too short on each ond, and therefore did not support the Z beam frame around the bottom. This was a deviation from the drawing, which called for the skids to be brought out right to the edge of the container and therefore supporting the Z beam and the entire panel load.

The marking pluque should also assist in indicating the front for loading and unloading.

Bolting size was increased from 3/8 = 16 NC to 7/16 = 14 NC to accommodate requests for stronger bolting. Some reports stated that threads stripped under load when closing container. Evidently the mating surfaces were drawn together and one or two

turns taken by hand on the polts, and upon releasing the load the threads stripped. This condition was probably aggravated by the fact that the bolting was not as originally specified, $3/8^{\circ}$ - 24 NF being furnished instead of $3/8^{\circ}$ - 16 NC, in which case each individual bolt thread was weaker.

The heavier roof sheet and the extra roof corrugation were considered desirable for increased durability, should the carrier attempt to use the cube above the container.

After the initial assembly by Oakland and Seattle, we have no further reports on assembly and disassembly, and conclude the containers were not shipped collapsed.

Appendix: (a) Shipment History

(b) Revised drawing

CARRIER	50 ft DD Box Car Mec Box Car	50 ft DD Box Car Mec Box Car Box Car	Truck-Enclosed Van	Natl Cridg Corp-Box Car Frt Car	Box Car	Box Car	40 ft SD Box Car 50 ft DD Box Car USS Rotecourt	Box Car	Box Gar		Box Car 401 68	Box Car	RR Car
	2201 1770	2210 2155 1680	16 90	1300	1930	1855	1894 1977 1750	1620	1730		1438	2025	1960
GROSS N	273 1 2300	2740 2685 2155	2220	1830	27,60	2385	2424 2507 2280	2150	1960		1968	2655	2500
RECEIVED	18 Jan 51 2. Jun 51	18 Jan 51 22 Jun 51	14 Mar 51	26 Feb 51	5 Jun 51		15 May 51 4 Sept 51 19 Oct 51				26 Mar 51		_
OH	N Om Fac Waside NAS Pensacola	N Gun Fac WashDC NAS Pensacola NSD San Diego	Charleston N.B. S. Car.	N Shryd Bklyn NY Clearfield	Ogden Utan NIN Supy 1 Bklyn	KD Sun Fiege	NSD Los Angeles NSC Norfolk Va NS San Juan FR	NSD Upton Ill	NSD San Diego Cal		KIN Shpyd Bklyn	KD Upton IL.	Oekland for Pearl Harbor
RG	NSD Seattle N Gun Fac WashDC	KED Seattle N Gun Fac WarnDC MAS Pensacola	NSD Seattle	KSD Seattle KIN Shpyd Bklyn	NED Clearfield	Ogden U. NIN Shpyd Bklyn	NED Seattle NED San Pedro NSC Norfelk Va		NSD Or Lakes Ill		OIC FTB NSC UKIN		KSD Or Lakes III
CLATHS	4 Jan 51 13 Jun 51	4 Jan 51 13 Jun 51 19 Nov 51		30 Jan 51 26 Mar 51		4 3ept 51	4 May 51 10 Jul 51 1 Oct 51	21 Jun 51	NO REPORT 15 Sept 51	NO REPORT	6 Mar 51	21 Jun 51	10 Jul 51
CONTAINER	R	М	~‡	<i>ب</i> ر			9	7		100	ø	2	

TET CARRIES	2695 SS Hawaiian Builder	1460 Box Cer	1680 MR Car	1580 Box Car	1810 Bex Car	1855 Box Car 50° 6° 1410 LBr 1079	1995 Lax Gar	1870 RR Car	1230 USNS Gen Aultman	1655 USNS Gen Aultman	1090 Motor Truck		1450 Box Car 1450 Truck	USS Corduba
CROSS N	3225 2	1990	2210	2110	2340 1	2385 1 1940 1	2525 1	2,000 1	1760	2185 1	1620		1980 1 1980 1	
TO RECEIVED	Fray 564 via SS Hawaiian Builder	Upton III	NSD San Diego	NSD San Diego	Upton Ill	NSD San Diego 24 Apr 51 FTO .ESC NorfelMa 30 Jul 51	Upton III	CIC FTB NWC Oakld for Pearl Harbor	Fray 564 via USIS Gen Aultmen	Fray 564 wis USNS Gen Aultman	NGD San Diego		N Gun Fac WashDC 12 Jul 51 USN Acad Annapolis NSD Guantanama Bay Sept-Oct	cuba a MSC Norfelk
FROM	FIB Oakland		NED Gr Lakes	FIB NSC Oakland		FTB NGC Oakland NGD Jan Diego		NSD Gr Lakes Ill	NSC Oakland Cal	FTF NGC Oakland	FTD NSC Oakland		FTD NSC Oakland N Gun Fac WashDC NSC Norfolk	Cuantaname BayCuba MSC Norfelk
ONGALIHS	Nov 51	23. Jun 5.1	22 Sept. 51	19 Jun 51	21 Jun 51	17 Apr 51 7 Jun 51	21 Jun 51	10 Jul 51	NO REPORT 31 Oct 51	31 Oct 51	16 Jul 51	NO REPORT	3 Jul 51 22 Aug 51 Sept-Oct	9 Mev 51
CONTAINER	п	ង		13	77	25	16			17	18	19	20	


10

N

2 Jun 51 14 Jul 51 14 Jul 51 26 Apr 51 19 REPORT 8 Nov 51 3 Jul 51	FTD NSC Oakland FTD NSC Oakland FTB NSC Oakland NSD Seattle Wash FTD NSC Oakland	NSC Oakland Phil N Shpyd Phil NSC Oakland N Sub Base Genr NSC Oakland Phil N Shpyd Phil NSC Oakland NSC Norfolk 9 Jun 51 NSC Oakland Phil N Shpyd Phil NSC Oakland NAS Millingtonffern NSC Oakland NAS Millingtonffern NSC Oakland N Gun Fac WashDC 4 Dec 51 NSC Oakland N Gun Fac WashDC 12 Jul 5 NSC Oakland N Gun Fac WashDC 12 Jul 5	9 Jun 51 4 Dec 51 12 Jul 51	2725 2270 2270 1810 2592 1640 1640 2435 2435	2195 1740 1280 1280 1110 1905 1580 1580	Box Car Box Car Box Car Box Car Box Car Trucks Trucks
1	H Gun Fac HashDC	E I S	Apr.	2110 2210 3210	1580	Trucks Box Car 50° 5°
	MED San Diego Call FID MEC Oakland M Gum Fac WashDC MSC Worfolk	FTO NSC Norfelk 30 Jul 5. N Gum Fac WashDC 12 Jul 5. USN Acad Annapolis Quantanamo BayCuba Sept-Oct	30 Jul 51 12 Jul 51 180pt-Oct	2450 2450 2450	1920 1920	Box Car Trucks
	وموا	Wan Wedlester	6 Feb 51	1780	1250	1250 40' ID Box Car

SHIPMENT BY SEA TRANSPORTATION - TABULATION

28 7 Jun 51 NGD San Diage Norfelk 2225 1695 LST 1079 (with 15)	CARLIE USS Bouteceart SS Hawaiian Builder USIR Gen Anltman USIR Gen Aultman USIR Cerduba LST 1079	1750 1680 1680 1230 1655 1695	2280 1 2280 1 3225 2 1940 1 1760 1 2185 1	San Juan FR Pearl Harbor Fray 564 Fray 564 Fray 564 KD Quantanama Bay Guba NSC Norfelk	MEC Norfelk NED Cr Lakes Ill FTB Oakland NED San Diego NEC Oakland NEC Oakland NEC Coakland NEC San Diego NEC San Diego	31 Oct 51 7 Jun 51 31 Oct 51 31 Oct 51 3 Oct 51 9 Nov 51	CONTAINER NUMBER 6 10 11 11 16 17 20 20 20 20 20 20 20 20 20 2
				NSP Guantanamo Bay Cuba	MSC Morfolk	Sent-Oct	8
	USS Corduba			NSC Norfelk	KED Guantanamo Bay Cuba	9 Nov 51	20
9 Nov 51 MSD Guartenamo Bay NSC Nowfelk Cuba				KED Quantanama Bay Cuba	NSC Morfolk	Sept-Oct	20
Sept-Oct MSC Morfelk MSD Quantaname Bay Guba 9 Mov 51 MSD Quantaname Bay NSC Morfelk Cuba		1655	2185	Fray 564	NSC Oakland	31 Oct 51	17
31 Oct 51 NSC Oakland Fray 564, 2185 1655 Sept-Oct NSC Morfolk NSD Quantanama Bay Cuba 9 Nov 51 NSD Quantanama Bay NSC Norfolk Cuba		1230	1760	Fray 564	MSC Oaklend	31 Oct 51	16
31 Oct 51 MSC Oakland Fray 564 1760 1230 31 Oct 51 MSC Oakland Fray 564 2185 1655 Sept-Oct MSC Morfolk MSD Quantaname Bay Guba MSD Quantaname Bay Guba 1655 9 Nov 51 MSD Quantaname Bay NSC Norfelk Cuba Cuba Properties		OL71	1940	Morfelk	KT San Diego	7 Jun 51	15 (with 28)
7 Jun 51 NGD San Diego Morfelk 1940 1410 31 Oct 51 NGC Oakland Fray 564 1760 1230 31 Oct 51 NGC Oakland Fray 564 2185 1655 Sopt-Oct NGC Morfelk NGD Quantaname Bay Cuba 1655 9 Nov 51 NGD Quantaname Bay NGC Norfelk AC Norfelk	3S Hewailan Builder	2695	3225	Frag 564.	FTB Oakland	Nov 51	-4
Mov 51 FTB Oakland Frag 564 3225 2695 7 Jun 51 MSD San Diego Morfelk 1940 1410 31 Oct 51 MSC Oakland Frag 564 1760 1230 31 Oct 51 MSC Oakland Frag 564 2185 1655 30 Oct 51 MSC Morfelk MSD Quantanama Bay Cuba 2185 1655 9 Mov 51 MSD Cuantanama Bay NSC Morfelk ASC Morfelk ASC Morfelk	8	3680	2210	Pearl Harbor		10 Jul 91	20
10 Jul 51 NED Cr Lakes Ill Pearl Harbor 2210 1680 Roy 51 FTB Oakland Frag 544 3225 2695 7 Jun 51 NED San Diego Borfelk 1940 1410 31 Oct 51 NEC Oakland Frag 564 1760 1230 31 Oct 51 NEC Oakland Frag 564 1760 1230 3ept-Oct NEC Rorfolk NEO Quantanama Bay Cuba 2185 1655 9 Nov 51 EED Guantanama Bay NEC Norfelk A Cuba	USS Boutecourt	1750	22.80	San Juan PR	KSC Norfelk	1 oct 51	9
1 Oct 51 KSC Norfelk San Juan PR 2260 1750 Jo Jul 51 KED Cr Lakes Ill Pearl Harbor 2210 1680 Kev 51 FTB Oakland Frag 564 3225 2695 7 Jun 51 KED Cakland Frag 564 1760 14.10 31 Oct 51 KSC Oakland Frag 564 1760 1230 3 toct 51 KSC Morfolk Frag 564 2185 1655 3 toct 51 KSC Morfolk KSD Quantanama Bay KSD Moantanama Bay Cuba 2185 1655 9 Nov 51 Cuba Cuba KSC Norfelk ASC Norfelk ASC Norfelk	Service Servic		TRUE SE	ឧ	TROM	CH 1976	MINER

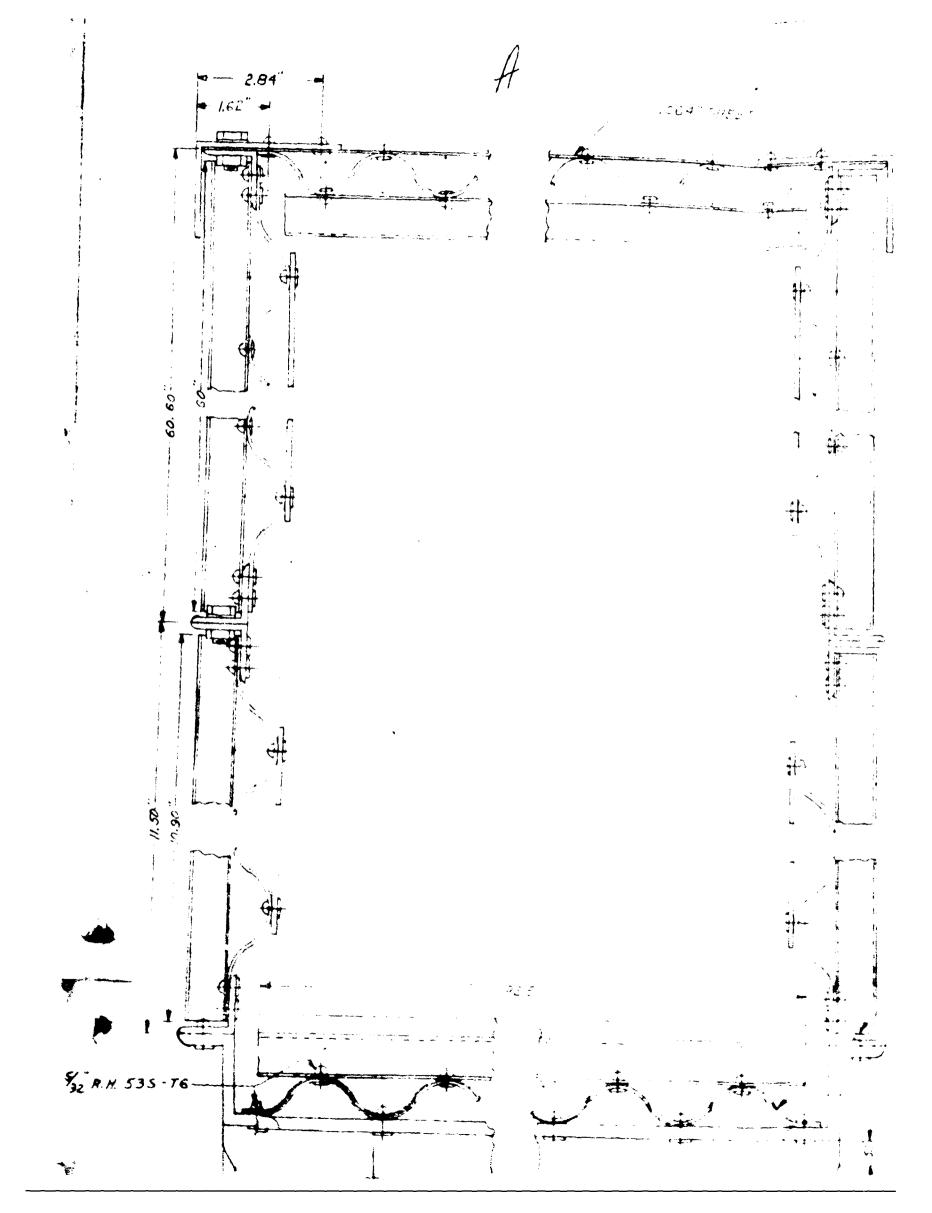

THE MIXING TE DOWN STRAFO ON FACH SIDE FLAGFF 1**9** FROM EACH CORNIN # \$F\$RE BULTS 3 & 7 3 % 1 3 % 332 ALUMONU 45 335558 3 NO

TYR FOR ALL VERT CORR. TRIM

3 8 m 332 mg


740.238 (99557) 34.245 (744


~ .


68 3/ ---

SESSION WE. 1 THE THE THE WARREN • •

కాలు కి.మీ.కి మమెక్కార్లు కి.మీ.కి కాలుకు కి.మీ.కి బహించి కి.మీ.కి కాలుకు కి.మీ.కి

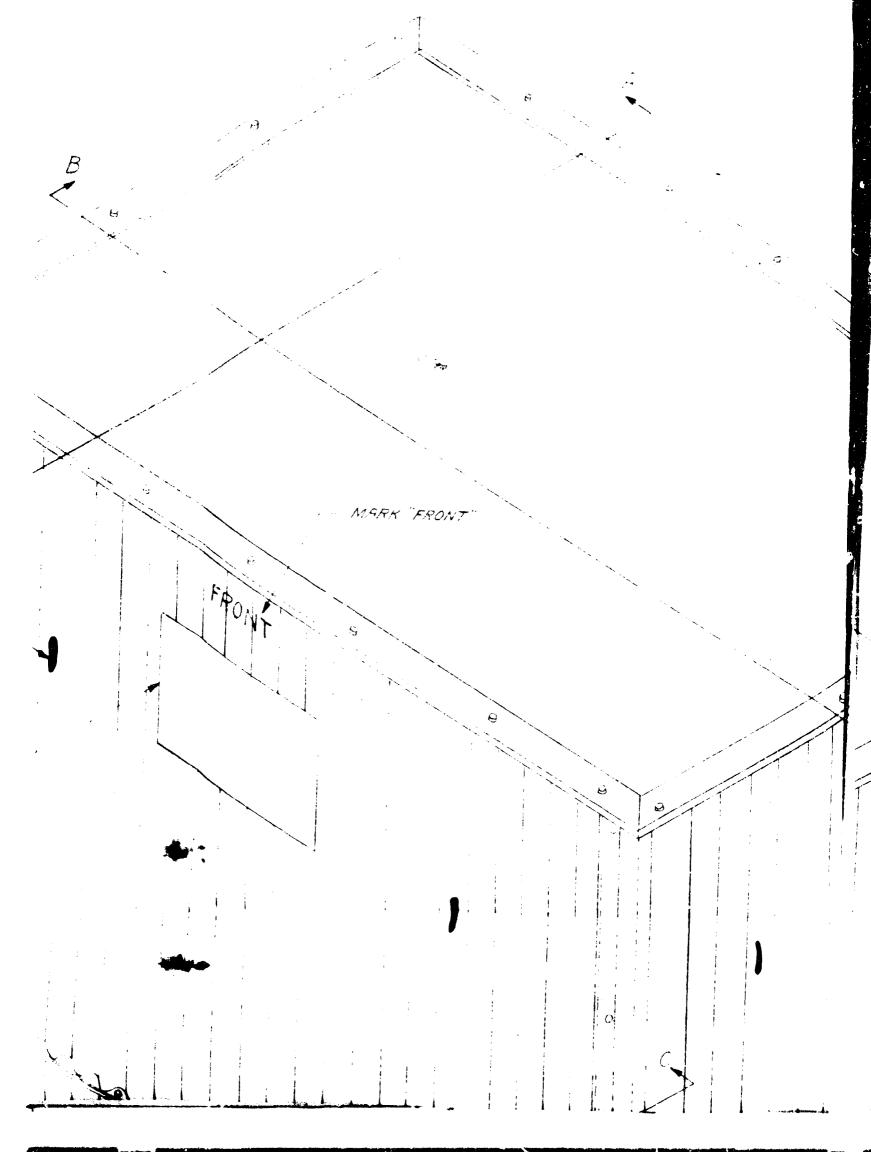

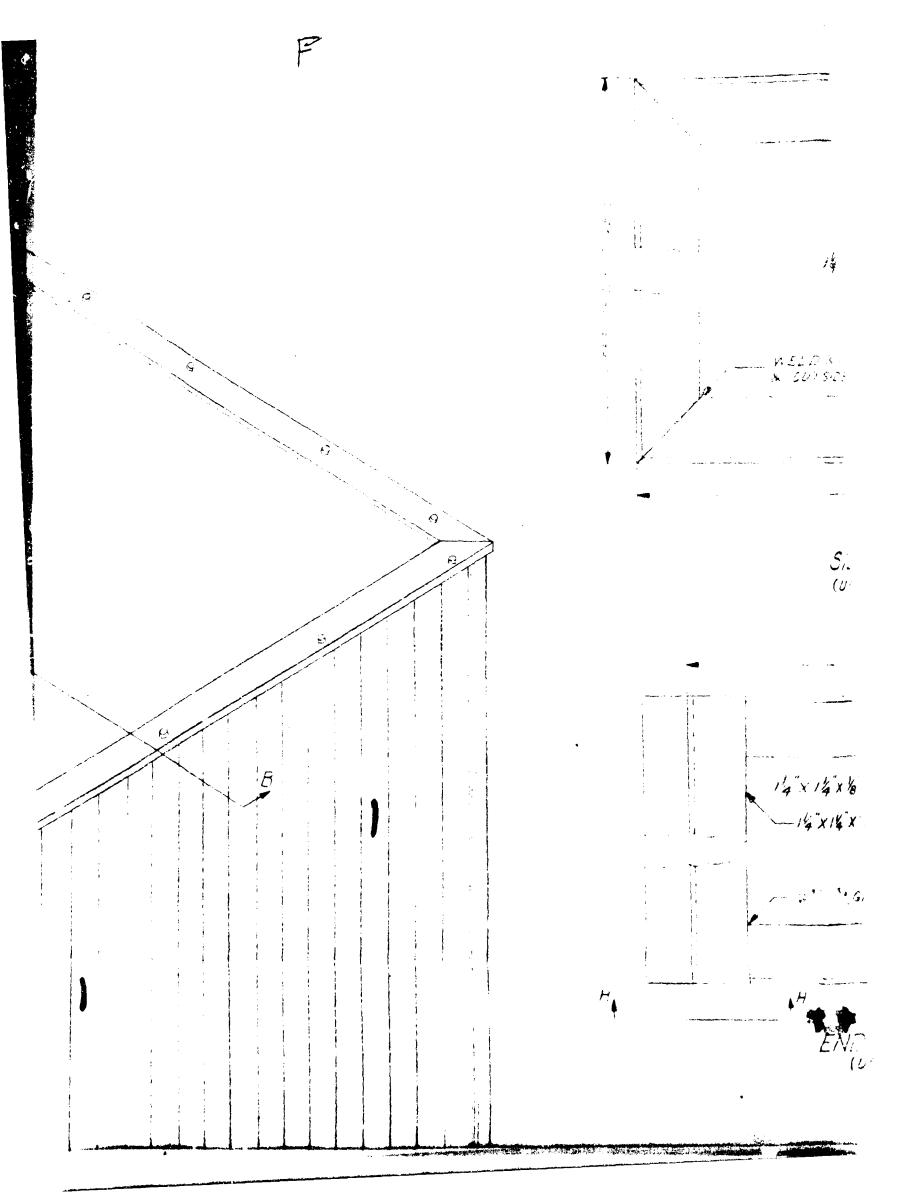

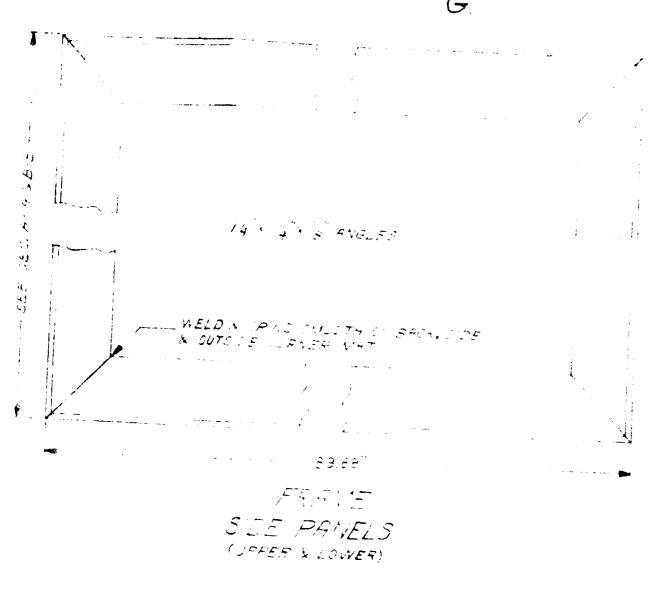

IN THE STEAMS

HEN THE STEAMS

IN TH

12 · 15

NOTES

MATERIAL TAL . CORRUGATION .. 032" INDUSTRIAL ALCEAD 1.6" FITCH - .87 DEEP ExTRUSIONS -

14 X 14 X & ANGLE
1" X 34" X 8" ANGLE
14" Y 2 X 14" X 36" Z
4" X 2 66 E BEAM 615-T6 635-75 615-76 615-76

PLATE -3/6" Shir - .032 & .064" 525-H32

STAPPO - 1" X 16" 52 5-H 32

STAPPO - 1" X 16" 52 5-H 32

ALL NOTS & BOLTS 16" X 14 N.C. STEEL -CAD. PLATE

TO ALTERNATE BOLT & PERMANENT THREADED FITTING

ALL. NASHERS - FLAT 16" X 1/6" 25-H 18

F VETS: SIDE & END PAVELS - CORR. TO CORR. RIVET EVERY

TURD BOTTON IN POTH DIPPOTIONS

TH'RO PITCH IN BOTH DIRECTIONS.


TOP - EVERY OTHER PITCH & STAGGER BETWEEN ROWS. BOTTOW- EVERY THIRD PITCH END- WISE & EVERY


GTHER PITCH LENGTH-WISE.


SIDE & END PANELS CORR. TO ANGLES - EVERY OTHER PITCH


I BEAM & PLATE TO CORR. - EVERY OTHER PITCH STAGSER ACROSS & OF BEAM.



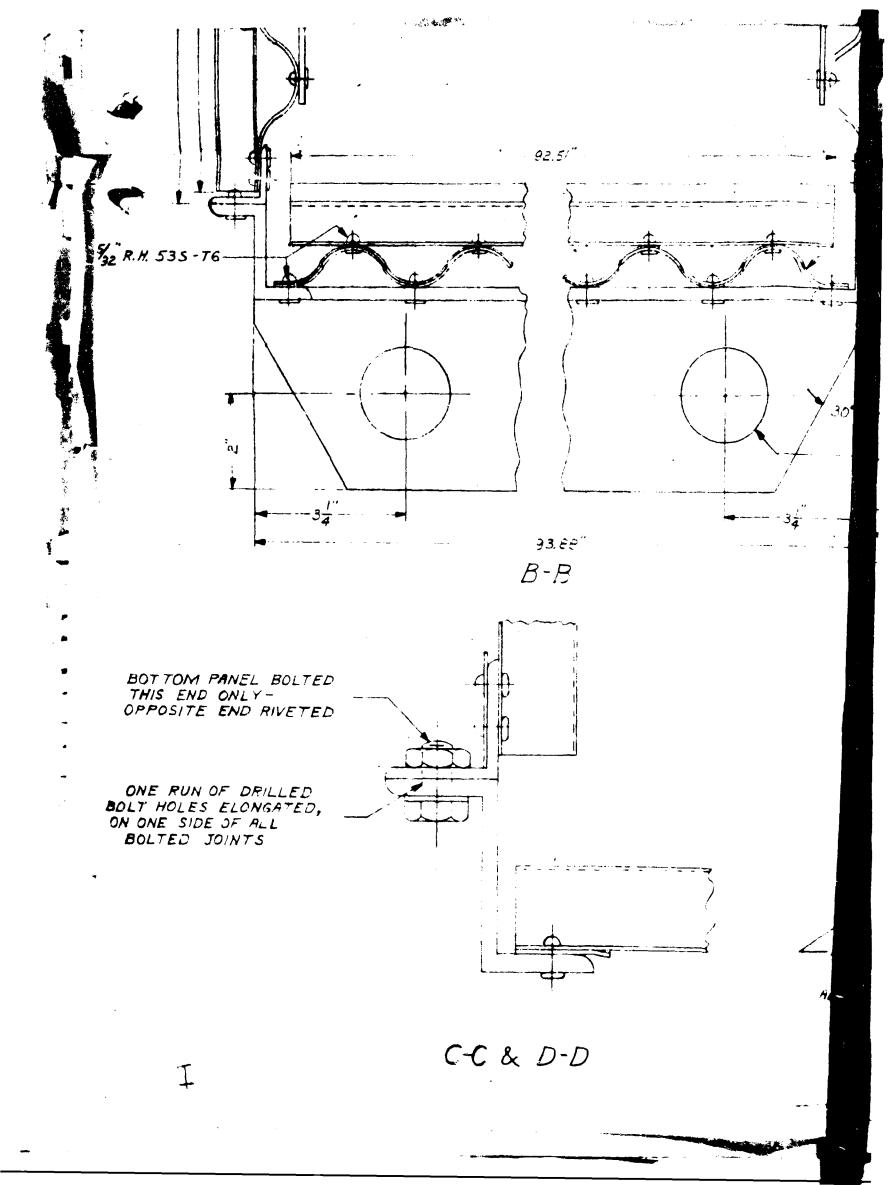

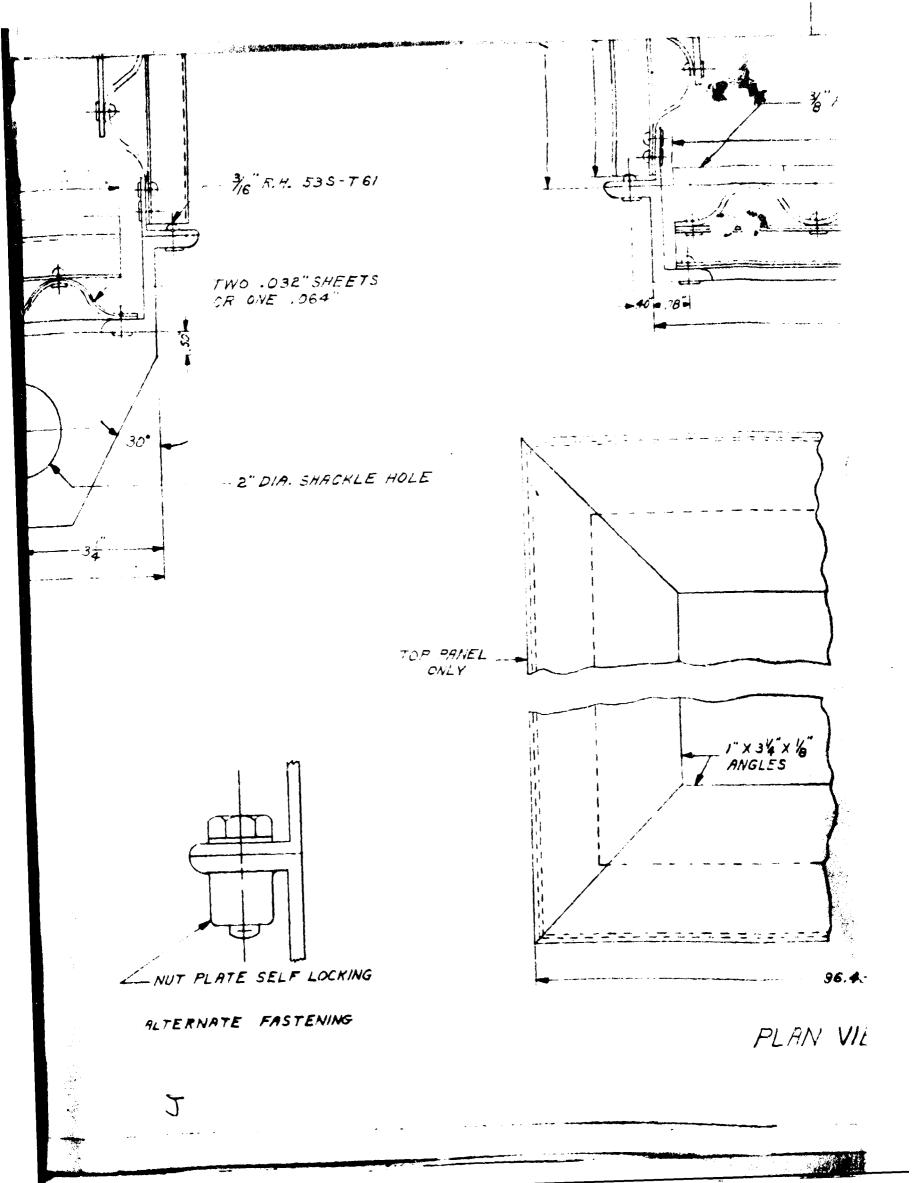

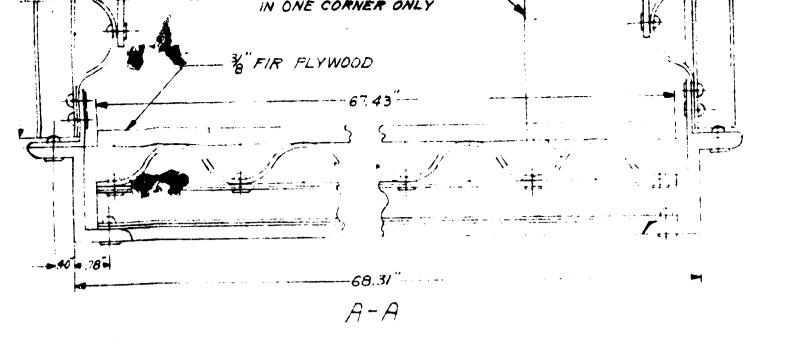


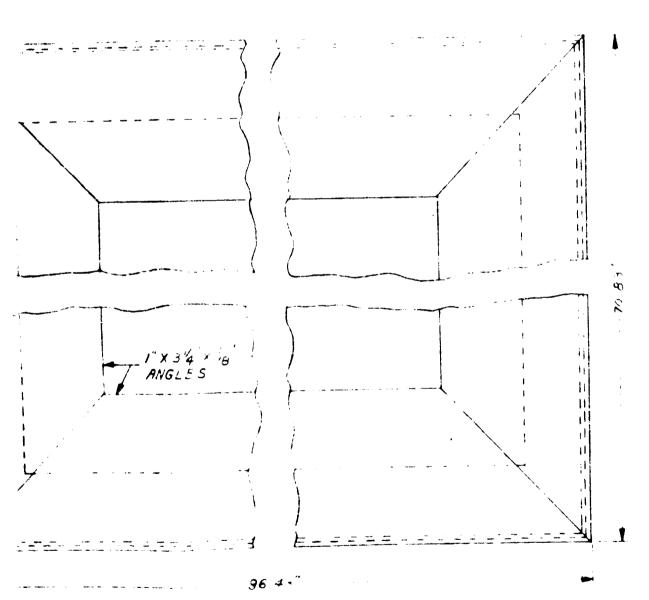



PLAN VIEW


K

Metho

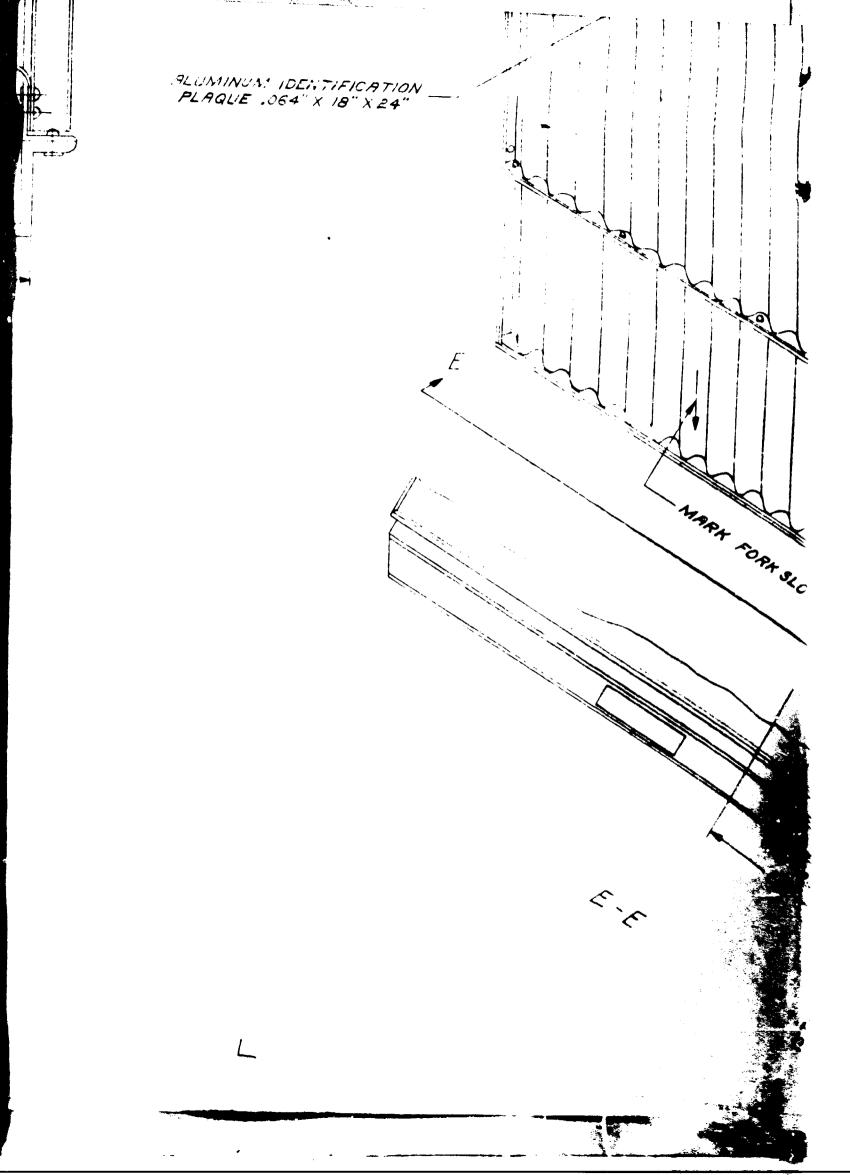

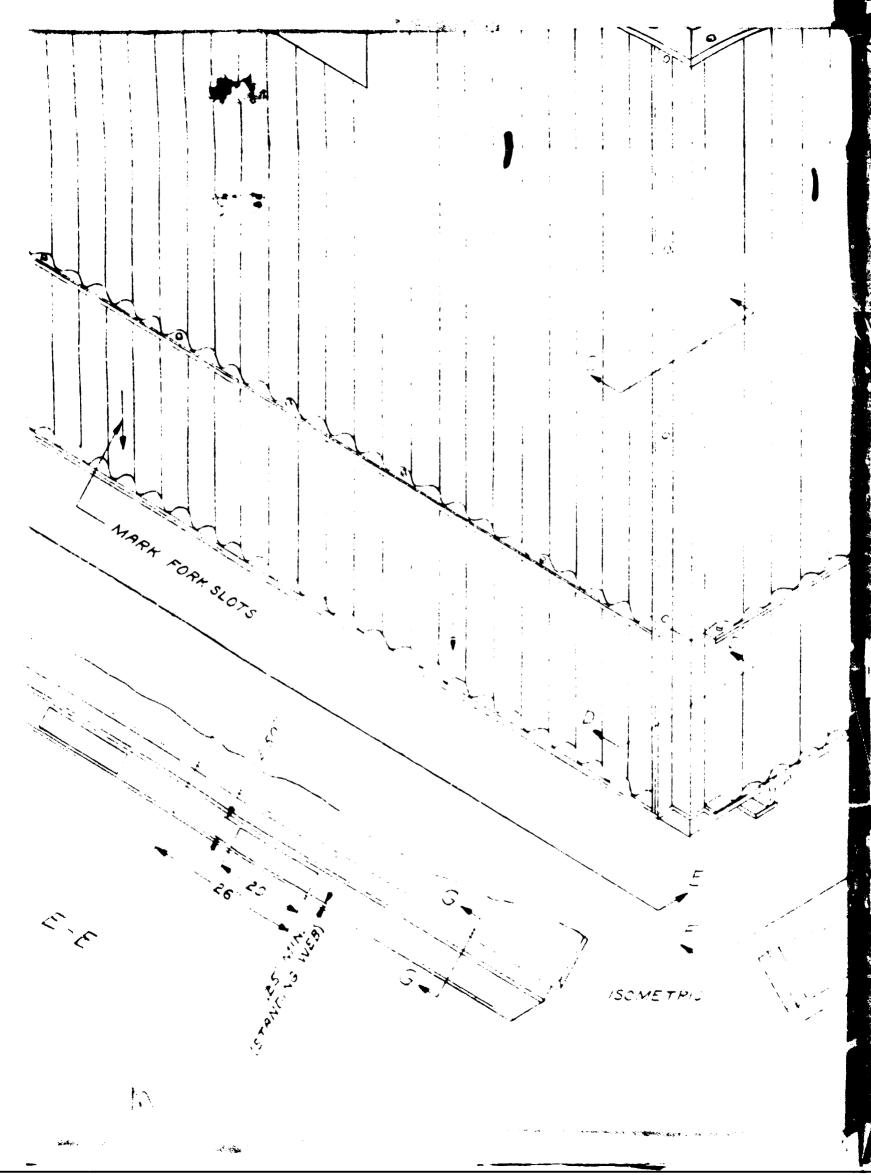

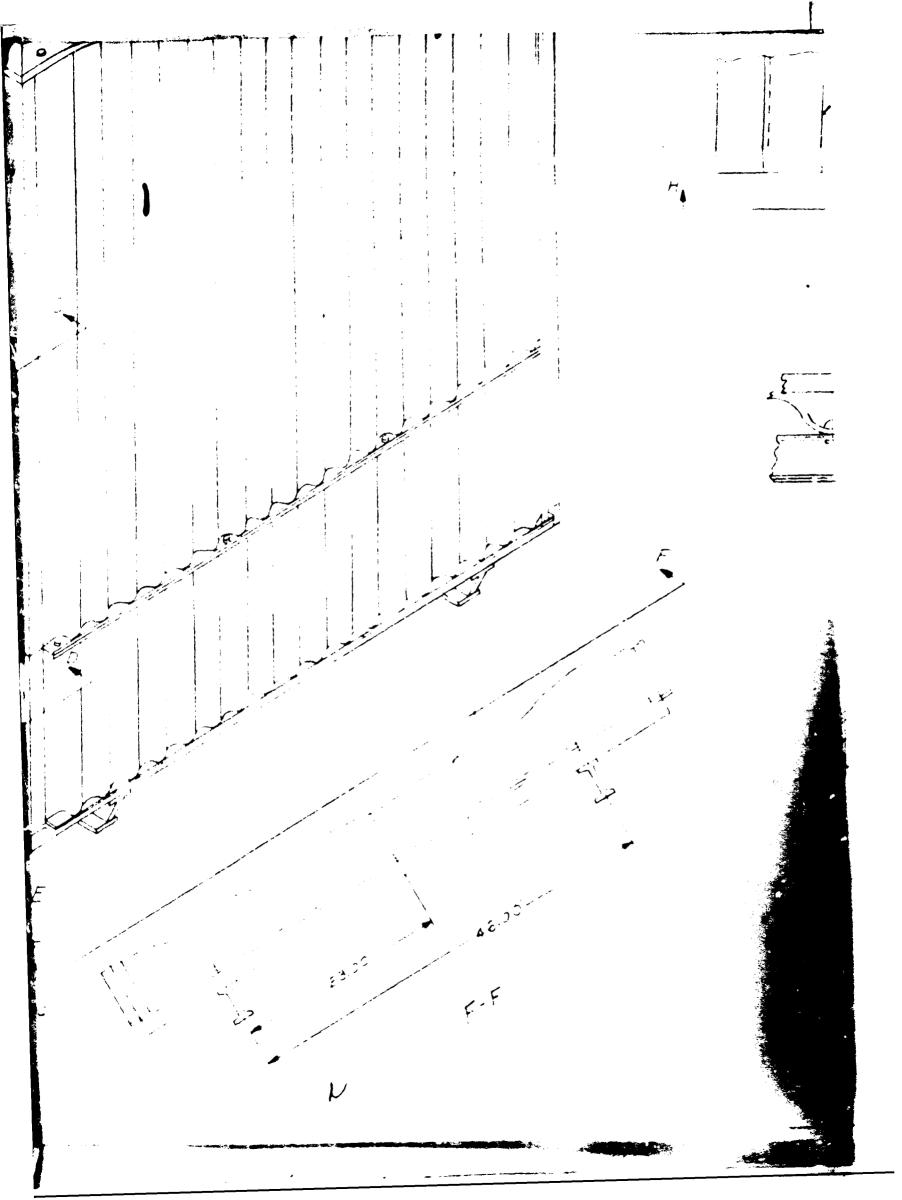

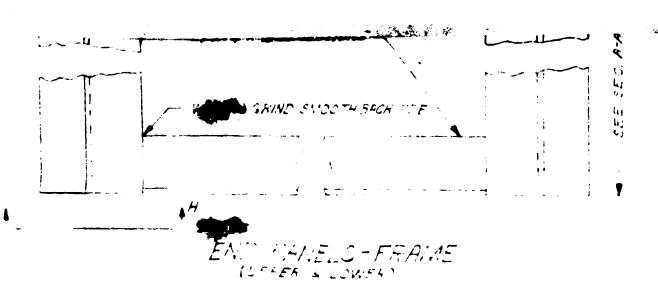

G-G

SCHER PLOTE BETWEEN F

SERRING PLATES

- 96 DIR, R.H. RIVET

SERVING PLATE

TYP SELIJE

CETAL 1

Ċ

4-4

THE MEST TOM

LEEN FORM

-5% SKT5

REMARAS

SEPARTMENT OF THE MANY BURSAN OF SURPLES AND ACCOUNTS

> COLLAPS/BLE CONTAINER

U.S. NAVAL SUPPLY RESEMAIN AND DEVELOPMENT FACILITY SUPPLY ENGINEERING DIVISION
BAYONNE, N.J.

DRAVIN BY: THE

APPROVED:

SHECKED AY:

DATE

P

DWG. NO. - SED -SK-335